
## City of Wichita, Kansas Americans with Disabilities Act Transition Plan

## Fire Station #10

1755 N. Grove

**July 2005** 

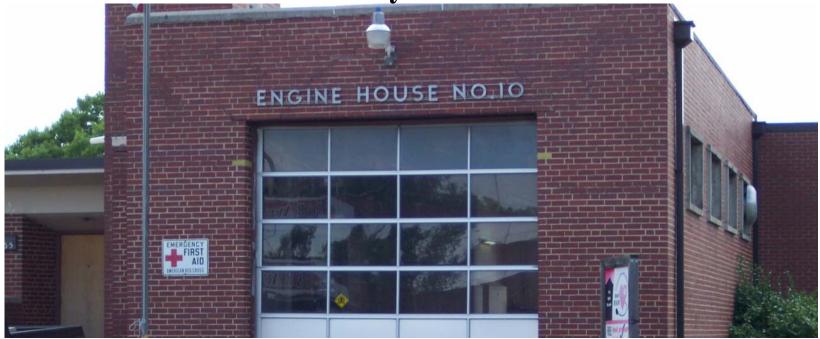

## **DMCG**

Disability Management Consulting Group L.L.C.

2801 Jonquil Place Columbia, MO 65202

In conjunction with

The Great Plains ADA & IT Center and the City of Wichita Disability Advisory Board

City of Wichita – ADA/504 Transition Plan – Fire Station #10 - July 2005

Legend: Blue font identifies hyperlinked documents – Red font indicates recommended changes to structures or policies

Locations	Structural Inconsistencies		Recommended Corrections/Modifications to Ensure Program Access	Criteria — L=low, M=medium, H=high			Supplemental Technical Information		Finalized Actions			
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)
1. Exterior	The main entrance is not accessible due to a flight of steps.	4.1.3( 8)	Two main requirements are provided in ADAAG regarding entrances/exists. 1) At least 50% of all entrances/exists must be accessible and located on and accessible path of travel. 2) Any entrance/exist required to exist due to local fire code must also be accessible. Whichever one of these requirements provides the most accessible entrances must be followed. Since the on-site City employees at this facility stated that the facility is closed to the general public, except for public school tours, and do to the numerous structural barriers at this facility, we do not recommend making modifications at this facility. We do recommend that any school tours be continued, but at another fire station, which is fully accessible. The accessible entrances should also coincide with the entrances used by the general public. Note: If not all entrances are made accessible, then directional signage, to accessible entrances, is required to exist at inaccessible entrances.	H	L	M	4	\$0	ADAAG  TAM II Program Access provisions			
2. Exterior	Designated accessible parking does not exist.	4.1.2( 5)	According to ADAAG, accessible parking spaces must exist in each parking lot, unless equivalent facilitation can be provided. The existing accessible parking signage has been removed and is lying on the ground. See previous Recommended Correction.	Н	Н	M	<u>5</u>	\$0	Accessible Parking Detail – Attachment A  TAM II Program Access Provisions			
3. Interior	Some interior doors have round knobs for door opening hardware.	4.13	According to ADAAG, any doors used by the general public in existing buildings are required to have opening hardware, which does not require tight grasping or twisting of the wrist to operate.  See previous Recommended Correction.	M	Н	M	1	\$0	Attachment B – Accessible Door Hardware  TAM II Program Access Provisions			

City of Wichita - ADA/504 Transition Plan - Fire Station #10 - July 2005

Legend: Blue font identifies hyperlinked documents - Red font indicates recommended changes to structures or policies

Locations	Structural Inconsistencies		Recommended Corrections/Modifications to Ensure Program Access	M	Criteria – L=low, M=medium, H=high		_		mental Technical nformation	Finalized Actions		
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Ac	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)
4. Interior	The ramp leading to the sleeping area has a very steep slope and no handrails.	4.8	See previous Recommended Correction.	H ®	Н	M	2	\$0	TAM II Program Access Provisions  Ramp Detail			
5. Interior	Restrooms are totally inaccessible due to numerous barriers.	4.23	Inconsistencies are too numerous to delineate without reproducing the entire ADAAG restroom specifications. ADAAG requires all public restrooms to be fully accessible in new construction. However, this facility is not considered new construction and, therefore falls under the program access provisions of Title II and on-site employees state that restrooms are never open to the general public. See previous Recommended Correction.	Н	Н	M	N A	\$0	Restroom Figures – Building Blocks			

<u>Fire Station #10 - Conceptual Cost Projections</u>

I II C D tutto II II I C C C C C C C C C C C C C C C	ptuur Copt I Tojections
Total	\$0
Year One (Very High)	\$0
Year Three (High)	\$0
Year Five (Medium)	\$0
Year Ten (Low)	\$0